


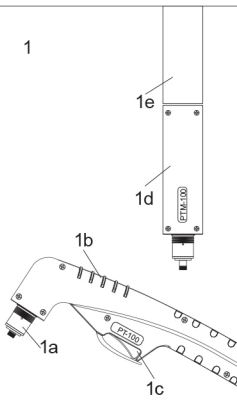



TECHNICAL DATA

MOD.	Current	Duty Cycle	Gas	Gas Pressure	Gas Flow	Pilot	Ignition
PT - 100	30-120 Amps	120 Amps 60%	Air/N ₂	70-80 psi (4.6-5.0 bar)	420 scfh (200 lpm)	Electrode to tip	Without HF

A RICHIESTA



CENTRAL CONNECTION

ITEM	Part. No	DESCRIPTION	ORIGINAL REF.	PACK
	PLTPT100.6.14	Torcia completa mt 6 terminale 1/4" G -Torcia completa mt 6 1/4" G connection		1
	PLPTM100.6.14	Torcia macchina completa mt 6 terminale 1/4" G -Machine complete torch mt 6 1/4" G connection		1
	PLTPT100.06	1a Corpo torcia -Torch head		1
	PLTPT81.08	1b Impugnatura -Hand grip		1
	02.09.A.BZ	1c Pulsante -Switch		1
	PLTPT100.06.M	1d Corpo torcia macchina -Machine torch head		1
PLTPT681.08.M	1e Impugnatura macchina -Machine handle		1	
	PLTPT100.05.1	Tubetto di raffreddamento -Cooling tube		10
	PLTPT100.01	3 Elettrodo -Electrode		10
	PLTPT100.01L	3a Elettrodo lungo -Extended Electrode		10
	PLTPT100.05	4 Diffusore aria 30-70 A -Switch ring 30-70 A		10
	PLTPT100.05.G	4a Diffusore aria 80-120 A gouging -Switch ring 80-120 A gouging		10

ITEM	Part. No	DESCRIPTION	ORIGINAL REF.	PACK	
	PLTPT100.02.09	5 Ugello 30-40 A	-Tip 30-40 A	10	
	PLTPT100.02.10	5a Ugello 40-50 A	-Tip 40-50 A	10	
	PLTPT100.02.11	5a Ugello 50-60 A	-Tip 50-60 A	10	
	PLTPT100.02.12	5a Ugello 60-70 A	-Tip 60-70 A	10	
	PLTPT100.02.14	Ugello 80-90 A	-Tip 80-90 A	10	
	PLTPT100.02.15	Ugello 100-110 A	-Tip 100-110 A	10	
	PLTPT100.02.16	Ugello 110-120 A	-Tip 110-120 A	10	
	PLTPT100.02.C10	5c Ugello a contatto 40-50 A	-Contact Tip 40-50 A	10	
	PLTPT100.02.C11	5c Ugello a contatto 50-60 A	-Contact Tip 50-60 A	10	
	PLTPT100.02.C12	5c Ugello a contatto 60-70 A	-Contact Tip 60-70 A	10	
	PLTPT100.02.C14	5d Ugello a contatto 80-90 A	-Contact Tip 80-90 A	10	
	PLTPT100.02.C15	5d Ugello a contatto 100-110 A	-Contact Tip 100-110 A	10	
PLTPT100.02.C16	5d Ugello a contatto 110-120 A	-Contact Tip 110-120 A	10		
	PLTPT100.02.G	Ugello gouging 120 A	-Tip gouging 120 A	10	
	PLTPT100.02.C10L	6 Ugello lungo a contatto 40-50 A	-Extended Contact Tip 40-50 A	10	
	PLTPT100.02.C11L	6 Ugello lungo a contatto 50-60 A	-Extended Contact Tip 50-60 A	10	
	PLTPT100.02.C12L	6 Ugello lungo a contatto 60-70 A	-Extended Contact Tip 60-70 A	10	
	PLTPT100.02.C14L	6a Ugello lungo a contatto 80-90 A	-Extended Contact Tip 80-90 A	10	
	PLTPT100.02.C15L	6a Ugello lungo a contatto 100-110 A	-Extended Contact Tip 100-110 A	10	
PLTPT100.02.C16L	6a Ugello lungo a contatto 110-120 A	-Extended Contact Tip 110-120 A	10		
	PLTPT100.03.1	7 Ugello esterno 30-70 A	-Retaining cap 30-70 A	10	
	PLTPT100.03.2	7a Ugello esterno 80-120 A	-Retaining cap 80-120 A	10	
	PLTPT100.03.C	Ugello esterno a contatto	-Shield cap body	10	
	PL.U60444	Distanziale a 2 punte	-Double pointed spacer	10	
	PLTPT81.04.CM	10 Distanziale taglio manuale 40-70 A	-Shield cap hand 40-70 A	10	
	PLTPT100.04.CM	10a Distanziale taglio manuale 80-120 A	-Shield cap hand 80-120 A	10	
	PLTPT81.04.G	Distanziale gouging	-Shield cap gouging	10	
	PLTPT81.04.CML	11 Distanziale taglio manuale lungo 40-70 A	-Extended shield cap hand 40-70 A	10	
	PLTPT100.04.CML	11a Distanziale taglio manuale lungo 80-120 A	-Extended shield cap hand 80-120 A	10	
	PLTPT81.04.CA	Distanziale macchina	-Shield cap machine	10	